


FILM-TECH

THE INFORMATION CONTAINED IN THIS ADOBE ACROBAT PDF FILE IS PROVIDED AT YOUR OWN RISK AND GOOD JUDGMENT.

THESE MANUALS ARE DESIGNED TO FACILITATE THE EXCHANGE OF INFORMATION RELATED TO CINEMA PROJECTION AND FILM HANDLING, WITH NO WARRANTIES NOR OBLIGATIONS FROM THE AUTHORS, FOR QUALIFIED FIELD SERVICE ENGINEERS.

IF YOU ARE NOT A QUALIFIED TECHNICIAN, PLEASE MAKE NO ADJUSTMENTS TO ANYTHING YOU MAY READ ABOUT IN THESE ADOBE MANUAL DOWNLOADS.

WWW.FILM-TECH.COM

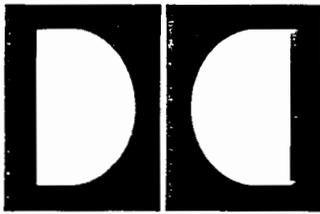

Dolby Laboratories Inc

Field Bulletin No. 161

INTERMITTENT AUDIO ON CP55 WHEN POWER IS SWITCHED ON


- Modification Urgent
- Modification Recommended
- Modification Required if Problem is Present
- Modification for Special Applications

Symptom No audio or a long delay on one or more channels when power is applied or the unit is switched from bypass to normal (any format).

Cause Some relays manufactured by STC occasionally develop contact resistance when used to switch audio. STC relays are easily identified by their white color and the brand name marking.



Solution Bypass relays (K1, K2, K3) should be replaced with audio relay--Part No. 51015 available from Dolby Laboratories. Please provide the serial number of your cinema processor when ordering. The relays are mounted in sockets. Be certain to observe the same orientation when replacing them (dot should be at the top).

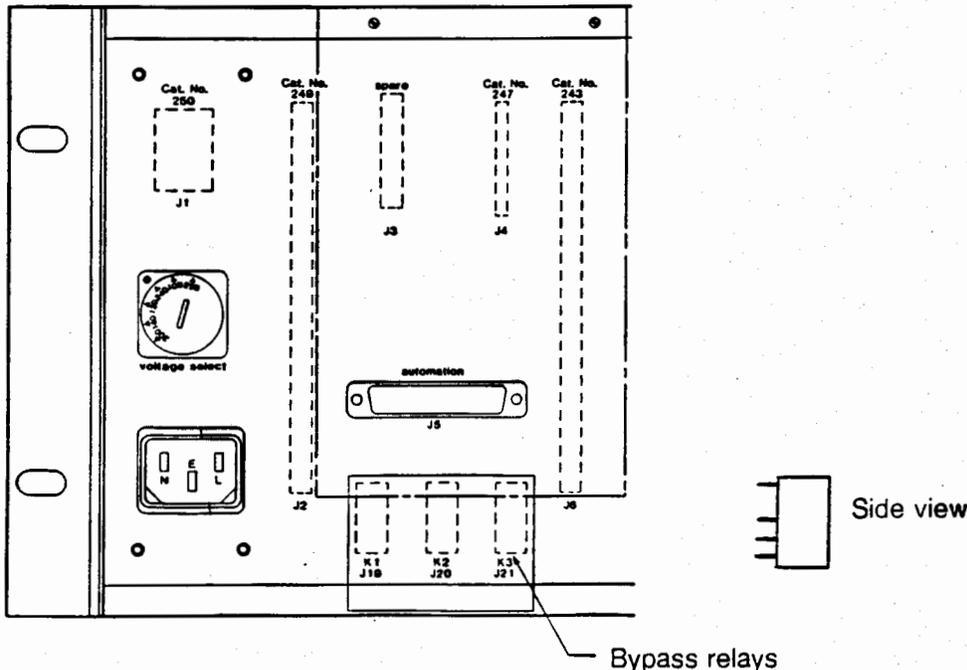

Signal Processing and Noise Reduction Systems

100 Potrero Avenue
San Francisco, California 94103-4813
Telephone 415-558-0200
Telex 34409
Facsimile 415-863-1373

346 Clapham Road
London SW9 9AP
Telephone 01-720-1111
Telex 919109
Facsimile 01-720-4118

December 1988
S88/853